

EZ-600-NMC-2 Connector Installation Procedure



1) Flush cut the cable squarely.



2) Strip the cable end using side 1 of the ST-600 clamp tool.



3) Debur the center conductor using a file or deburring tool.



4) Strip the jacket using side 2 of the ST-600 clamp tool.



5) Make sure the braid is straight . Square the connector with the cable and twist onto the cable until it bottoms on the jacket



6) Flare out the braid as shown.



7) Begin threading the front of the connector onto the back end while keeping the back end firm against the jacket.



8) Tighten firmly with two 1" wrenches.