




SZ-100-BM
3190-2243


**BNC Male (Plug) Straight Non-Solder
Pin Connector for LMR-100A Cable**

Made in China


Installation Instruction

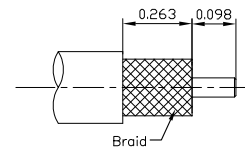


1. A. Trim cable to dimensions shown. Be careful to avoid nicking the braid
B. Remove any residual plastic from center conductor
C. Deburr center conductor using a fine file or Times DBT-U tools
D. Avoid nicking aluminum tape or center conductor

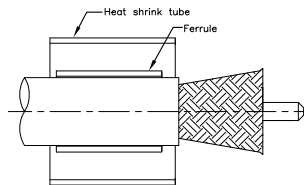

2. A. Slide crimp ferrule and heat shrink tube over the cable
B. Flare the braid

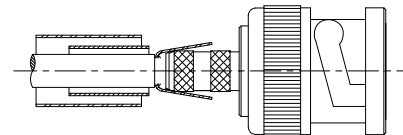

3. A. Insert Cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.
B. Trim excess braid flush to shoulder on connector body

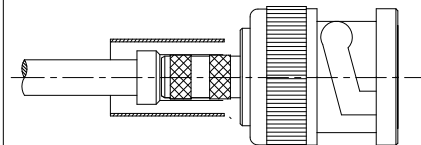

4. A. Slide crimp ferrule over braid and crimp as close to body as possible using .128" HEX crimp tooling. Pay attention to the crimp area, do not crimp rear of crimp sleeve
B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun