

3 1 9 0 - 6 2 7 7


SC-100-SF
3190-6277

SMA Female (Jack) Straight Solder Pin
Connector for LMR-100A Cable

YYWW


Made in China

Installation Instruction

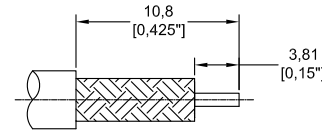


1. A. Trim cable to dimensions shown. Be careful to avoid nicking the braid
B. Remove any residual plastic from center conductor


Recommended Cable
Strip dimensions

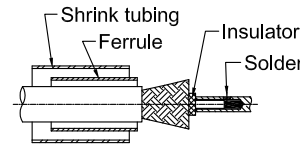

2. A. Solder the contact pin and inner conductor of cable
B. Slide the ferrule and shrink tubing over the cable
C. Flare the braid

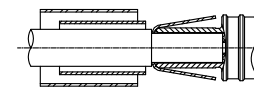

3. A. Insert cable into connector body until dielectric is seated with all braid wires on outside of connector body

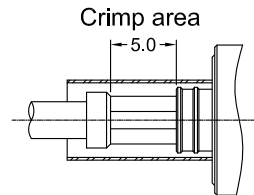

4. A. Slide the ferrule over braid and crimp as close to body as possible using .128" HEX crimp tooling Pay attention to the crimp area, do not crimp rear of crimp sleeve
B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun