


3 1 9 0 - 6 4 3 4

EZ-200-SM-X
3190-6434


**SMA Male (Plug) Straight Non-Solder
Pin No Braid Trim Connector for
LMR-200 Cable**

Made in China


Installation Instruction

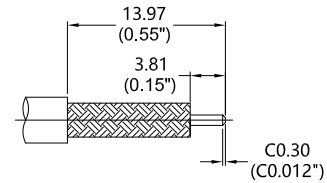


Dimensions in millimeters (inches)

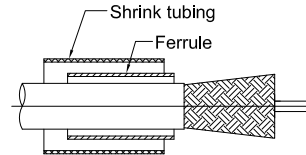

1. A. Cut the cable squarely while keeping it round using the CCT-02 cutting tool.
- B. Trim cable to dimensions shown using the CST-195/200 prep tool.
- C. Remove any residual plastic from the center conductor.
- D. Debur center conductor using a fine file.

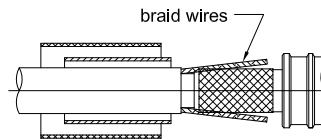

2. A. Slide shrink tubing, crimp ferrule over the cable as shown.
- B. Flare the braid.

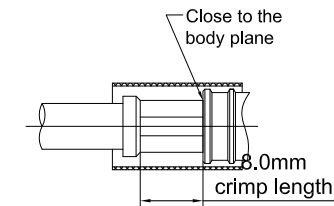

3. A. Insert cable into connector body until dielectric is seated and center conductor is inserted fully into connector center pin.
- B. all braid wires on outside of connector body

4. A. Slide the ferrule over braid and crimp as close to body as possible using .213" HEX crimp tooling, Pay attention to the crimp length, do not crimp rear of crimp sleeve
- B. Heat shrink tube over rear of connector body and down on to cable jacket using hot air gun



Times supply rubber boot 3109-445(WSB-195/200) as an option to instead of heat shrink tube.

Refer to www.timesmicrowave.com for install videos